
		TECH DOC
INFO.ORIGININTL.COM		

## **“After installing SOLIDWORKS and CheckMate 14, I am Unable to Create CheckMate Measurements on my CAD”**

### **SYMPTOM:**

After installing SOLIDWORKS and CheckMate 14, picking points for measurements is unsuccessful. Measurements that you create on the CAD get projected out into space, if they get created at all.

**SOLUTION:** there are some setting in the SOLIDWORKS Options setting screen that need to be checked. We recommend that you try changing one setting at a time, and verify if that resolves the issue.


**1- Enhanced graphics performance**

**AND**

**2- 3D interconnect**

**Screenshots of both of these items are shown below.**

# 1) Uncheck the “Enhanced graphics performance (requires SOLIDWORKS restart)” checkbox

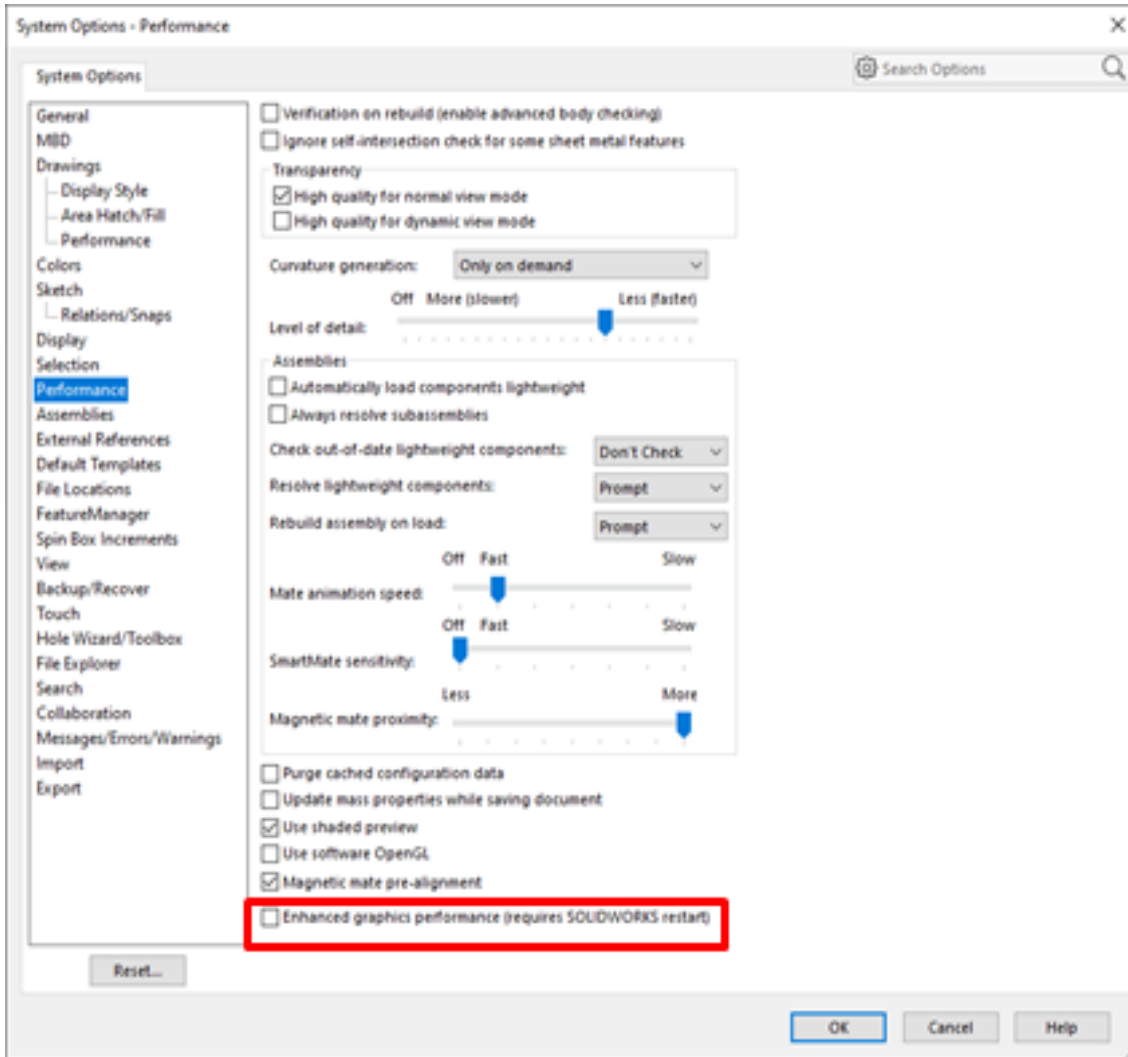

## 2) Uncheck the “Enable 3D interconnect” checkbox

